


## Kitchen Island Venting

### SPECIAL VENTING FOR ISLAND FIXTURES

Traps for island sinks and similar equipment shall be roughed in above the floor and may be vented by extending the vent as high as possible, but not less than drain board height. The vent is then returned downward and connected to the horizontal sink drain immediately downstream from the vertical fixture drain. Figure 6-16 illustrates the construction of the completed island venting system.

The returned vent shall be connected to the horizontal drain through a Y-branch fitting, (see "b" in Fig. 6-16) and shall in addition be provided with a foot vent taken off the vertical fixture vent by means of a Y-branch fitting immediately below the floor. This foot vent extends to the nearest partition and thence through the roof to the open air, or may be connected to other vents at a point not less than (6) inches (152.4 mm) above the flood level rim of the fixture served. (See Fig. 6-16)

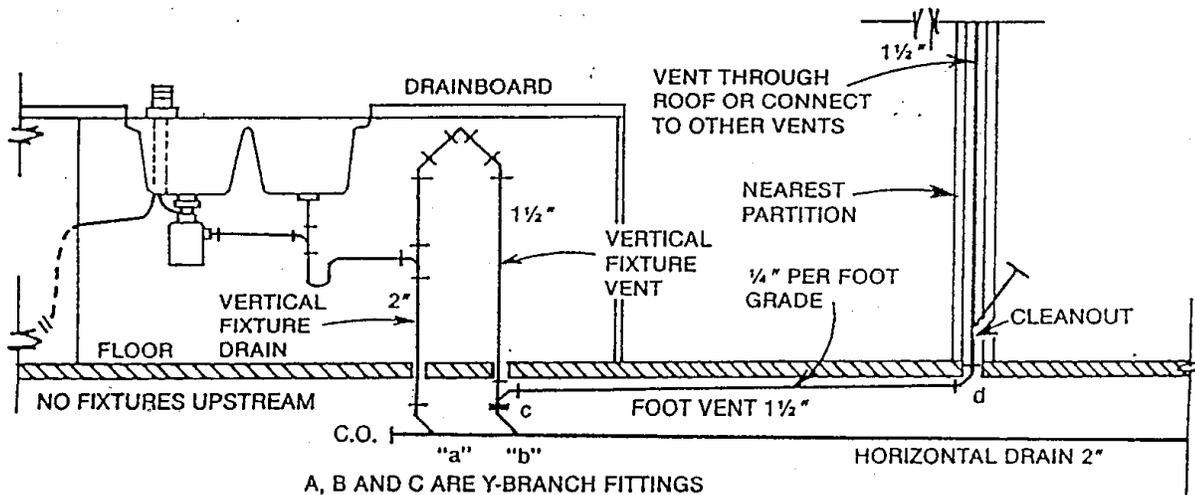

A, B AND C ARE Y-BRANCH FITTINGS

Fig. 6-16 Complete

**Building Division Counter is open between the hours of 7:30 a.m. and 5:30 p.m. (closed for lunch 11:30 a.m. - 12:30 p.m.) Monday through Thursday. City Hall and the Building Division counter are closed on alternating Fridays ([see calendar](#)). Our Friday hours are 8:00 a.m. – 5:00 p.m. (closed for lunch 11:30 a.m. - 12:30 p.m.).**

**\*\*\*Please contact the Poway Building Division if you have any questions or concerns at (858) 668-4645 or [building@poway.org](mailto:building@poway.org)\*\*\***